
TECHNICAL SERVICE BULLETIN


TO: All Uniden Private Radio Communication Dealers,
Distributors and Warranty Service Stations

REFERENCE: SPS801TS, SPS802TS, SPS801TSE, SPS802TSE

SUBJECT: SUB PCB ASSEMBLY

GENERAL: It has been brought to our attention that it is possible for the SUB PCB to pop loose from J111 causing decode failure. This may occur when radio is dropped several times, usually face down.

To prevent the possibility of this happening we suggest that a foam cushion part number RCUN453098Z, or something similar, be added inside the lower shield plate as shown below. Be careful not to cover the adjustment potentiometers.

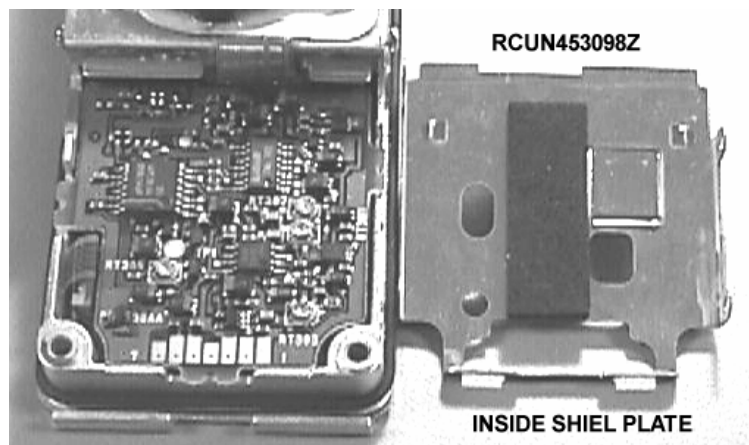

PRIVATE RADIO COMMUNICATIONS

Technical Bulletin Board 817-858-3617 (Terminal Emulation: ANSI.BBS/8 Data Bits/1 Stop Bit/No Parity)